# Original Research Article

Evaluation of the Effectiveness of the Treatment of Bonny pipe borne water.

#### **ABSTRACT**

The research was aimed at evaluating the microbiological and physicochemical quality of Bonny Pipeborne water. The Pipeborne water from Bonny Island in Rivers State was screened to evaluate the effectiveness of it's treatment by Bonny water board company. The microbiological status of the water was determined by using basic growth media to isolate microorganisms present in the water and identifying the organisms using it's morphological characteristics. Antibiotic susceptibility was then carried out to ascertain the resistance and sensitivity of the isolates. Swabs of the water outlet taps were also taken at each point of collection from source to delivery. The results were compared with the microbiological status of Omoku's Pipeborne water. Physicochemical Analysis was also carried out on the Bonny pipeborne water to determine the level of chemical contamination. The Bonny Pipeborne water complied with the microbiological regulations of WHO as there was no bacterial and fungal growth on any of the media used. However, the total heterotrophic bacteria count of the Omoku's water was 2.10 × 10^2 thus exceeding the limit of 1.0 × 10^1 cfu/ml of water, the MPN count for total coliforms was 5MPN/100ml, there was no Faecal coliform present and isolated organisms were *Salmonella* sp., *Bacillus* sp., *Micrococcus* sp. and *Vibrio* sp.. The Physicochemical composition analysis revealed the following result for untreated and treated Bonny pipeborne water samples respectively: pH (7.0 and 7.5), Conductivity (60 mg/L and 268mg/L), Total Dissolved Solids (30mg/L and 34mg/L), total hardness (12.012mg/L and 120.12mg/L), chloride (10mg/L and 12mg/L) and Chlorine (Nil and 7.1mg/L) amongst others. The chlorine level for the treated water was above the regulatory standard of WHO (5mg/L), this resulted in increased hardness, taste and odour of the water, which were also above WHO's regulatory limits. Therefore, the Bonny water is not within the regulatory standard of potable drinking water.

Keywords: Pipeborne Water, Bonny Island, Physicochemical parameters, Most Probable Number.

#### **INTRODUCTION**

Water plays an important role in nourishing the body, making it very essential for the human body. In Bonny Island, located at the southern edge of Rivers State in the Niger Delta Region of Nigeria, the main source of drinking water is Pipe borne water supplied to it's indigenes by the Bonny Utility Company (BUC). Hence, knowledge on the microbiological and physicochemical parameters of the drinking water is essential, as when impure and unsafe water is ingested can cause mild to severe water borne diseases. Thus, it is essential to determine if the indigenes of Bonny Island are supplied with safe and good quality pipeborne drinking water.

The quality of source water is a major factor in the quality of drinking water, the treatment process also plays a major role in the quality of drinking water as well as the water distribution system, the tanks and household filters used for storage. (Peiyue L. & Jianhua W. 2019).

The scope of the work encompasses the microbiological and Physicochemical analysis of Bonny pipeborne water, which receives a 2ry, 3ry, advanced? treatment You should mention this in order to set up goals to be reached, and understand the water quality at the delivery point. Swabs of the water outlet taps were also taken at each point of collection from source to delivery. Antibiotic susceptibility testing was then carried out to ascertain the resistance and susceptibility of the test isolates. Physicochemical analysis was also carried out on Bonny pipeborne water. The aim of the study is to evaluate if the Bonny treatment process of the pipeborne drinking water is right, and determine if the treatment process is within required standards.

#### **MATERIALS AND METHODS**

# **Description of Study Area**

This study was carried in Bonny Local Government Area of Rivers State, Nigeria. This study area was chosen in order to ascertain the quality of pipeborne drinking water supplied to the indigenes of the area.

## **Sample Collection**

Samples were collected at four different water outlets in Bonny. The first water source was the untreated water outlet from the company's reservoir, the second source was from the treated water outlet from the company's reservoir, the third water source was from a household in the island and the fourth water source was from a community tap. A total of four water samples were taken.

#### Microbiological analysis

Water

Nutrient agar, potato dextrose agar, Centrimide agar, Eosin Methylene Blue agar, Thiosulfate-citrate-bile salts-sucrose agar (TCBS) agar and Salmonella Shigella agar were prepared according to manufacturer's instructions for each of the water sample. Sterile Petri dishes were arranged on the work bench and labelled accordingly. 1ml of the sample was poured directly without diluting into the sterile Petri dish and the growth media was poured and allowed to solidify. The same procedure was repeated for each sample and growth media. The inoculated Petri dishes were incubated for 24 hours at 37°C.

Swab

After the prepared sterile agar plates were properly dried, the sterile swab sticks which were used to swab the water tap at each distribution point were used to make a smear on the prepared sterile, Nutrient agar, Potato Dextrose agar, Centrimide agar, Eosin Methylene Blue agar, TCBS agar and Salmonella Shigella agar plates, and then a wire loop was aseptically used to streak from the point the smear was made. This same procedure was repeated for the rest of the samples, labelled respectively and incubated for 24 hours at 37°C.

MPN? Meaning?

#### Presumptive Test for MPN of coliforms

This is used to enumerate and identify the presence of Coliform organisms in the water sample. Lactose broth was prepared in three Mc Cartney's bottles respectively, Durham tubes were inserted in an inverted position and the broth was autoclaved and allowed to cool. 0.1ml (Single Strength), 1ml (Single strength) and 10mls (double strength) of water sample were inoculated into three of bottles respectively, labelled properly and incubated for 24 hours at 37°C.

## **Characterization and Isolation of the Tested Organisms**

Distinct colonies were picked from the incubated plates after 24hrs and characterized morphologically. The distinct colonies were then sub-cultured onto prepared nutrient agar plates and incubated for 24hours at 37°C, to obtain pure cultures of the organisms (Taylor, 2008).

### **Preservation of pure culture**

The pure cultures were stored in nutrient agar slants within Mc Cartney's bottles at -4°C in a freezer.

## **Identification of the Bacterial Isolates**

Identification of the bacterial isolates was carried out through biochemical test such as Catalase, indole test, oxidase, Citrate Utilization test, Methyl red, Voges Proskaeur test, while sugar fermentation test was used to confirm the test organisms (Cheesbrough, 2006).

## **Antibiotics Susceptibility Testing**

The recovered organisms were subjected to antimicrobial susceptibility testing using several antibiotics according to their gram's reaction. For the Gram negative isolates; Tarivid (OFX) 10mcg, Reflacin (PEF) 10mcg, Ciproflox (CPX) 10 mcg, AUG mention (AU) 30mcg, Gentamycin (CN) 10mcg, Streptomycin (S) 30mcg, Ceporex (CEP) 10mcg, Nalidixic acid (NA) 30mcg, Septrin (SXT) 30mcg and Amplicin (PN) 30mcg. For the Gram postive isolates; Ciproflox (CPX) 10 mcg, Norfloxacin (NB) 10mcg, Gentamycin (CN) 10mcg, Amoxil (AML), Streptomycin (S) 30mcg, Rifampicin (RD) 20mcg, Erythromycin (E) 30mcg, Chloramphenicol (CH) 30mcg, Ampiclox (APX) 20mcg, Levofloxacin (LEV) 20mcg. A sterile swab stick was used to collect fresh inoculum from a 24 hour culture corresponding to 0.5 Mc Farland turbidity standard and swabbed evenly across the plates. The antibiotic disc was placed on the surface of the inoculated Nutrient agar plates with the use of a sterile forcep. The plates were reversed within 30 minutes of applying the disc and incubated for 24hours at 37°C, the zones of inhibition were read and classified as susceptible, intermediate, or resistant.

## **Physicochemical analysis**

Different analytical methods were used to ascertain the presence and amount of certain chemicals in the water samples. Physical parameters like taste, odour, appearance and clarity of the water samples were determined by Physical observation while Chlorine, Chloride, total hardness and nitrate levels were determined by titrimetric methods.

Otherwise, for heavy metals analysis, Atomic Adsorption Spectrophotometer was just to determine the presence of lead, iron and zinc.

#### RESULTS AND DISCUSSION

**Physicochemical Properties of Pipe-borne Water Samples** 

The physiochemical analysis carried out on pipe-borne water sourced from Bonny for both treated and untreated water revealed that untreated water was more turbid than the treated water. However, the pH, Conductivity, Total Dissolved Solids (TDS), total hardness and chlorine levels for treated water was more than the untreated as the pH levels for untreated and treated water samples were (7.0 and 7.5), Conductivity (60 mg/L and 268mg/L),Total Dissolved Solids (30mg/L and 34mg/L), total hardness (12.012mg/L and 120.12mg/L), chloride (10mg/L and 12mg/L) and chlorine (Nil and 7.1mg/L) respectively. The chlorine level in the treated water was higher than the untreated water. Results for other physicochemical parameter analysed are reported in table 1, in which there are untreated and treated water values vs the World Health Organization (WHO) standards in 3<sup>rd</sup> column

Do You have the data for the 3<sup>rd</sup> and 4<sup>th</sup> source points? It should be included in table 1

**Table 1: Physicochemical Properties of Pipeborne Water Samples** 

Parameter	Untreated	Treated	WHO/FM.Env.
Apperance	Turbid	Clear	Clear
Odour	Odourless	Present	Odourless
Colour	Brown	Colourless	Colourless

Taste	Present	Present	Tasteless
Particles	Present	Absent	Absent
рН	7.0	7.5	6.5 - 8
Total Dissolved Solids	30	134	600
(TDS), (mg/L)			
Conductivity(mg/L)	60	268	300
Alkalinity(mg/L)	13.38	4.48	100
Salinity (PPT)	0.03	12.85	100
Turbidity(NTU)	8.00	3.00	5
Total Hardness (mg/L)	12.012	120.12	100
Chlorine (mg/L)	Nil	7.1	5
Chloride (mg/L)	10	12	250
Sulphate (mg/L)	4.92	0.27	N
Nitrate (mg/L)	0.85	0.75	50
Phosphate (mg/L)	2	1.11	N
Zinc (mg/L)	1	-2.15	N
Iron (mg/L)	24.55	4.4	N
Lead (mg/L)	Nil	Nil	10

Key: N = No guideline value WHO(2006).

Results gotten for the total heterotrophic bacterial count revealed that both treated, untreated, community and household water samples sourced from Bonny had no growth on general purpose media. However, sample Sourced from Omouku had a T..H.. B.. C (THBC) meaning? count of  $2.0x10^3$  cfu/ml.

Table 2: Total Heterotrophic Bacteria Counts Of Pipe-Borne Water Samples.

Sample cite	Cfu/ml	Log (Cfu/ml)	WHO Standard
Н	-	0	<1.0x10 <sup>1</sup>
С		0	
U		0	
Т		0	
0	2.0x10 <sup>3</sup>	3.301	

Key= H= Household water; C = Community water; U= Untreated water; T = Treated water; O= Omoku water


Pseudomonas sp. was not present in any of the samples studied.

Counts obtained on Salmonella Shigella agar was 6.5x101 for the sample sourced from Omouku while all the samples from Bony were negative for *Salmonella* sp.

Culture done on T..C..B..S. (TCBS) meaning showed negative for all the samples from Bonny but the sample sourced from Omouku had *vibrio* sp. Count of  $6.5 \times 10$ .No E. coli was found in any of the samples studied. Only the sample sourced from Omouku had a count of  $1.35 \times 10^2$  on PDA. All other samples were negative.

The most probable number for determining total coliform revealed that all samples from Bonny had less than 2 MPN/100ml while the Omouku sample had 5 MPN/100ml. none of the was positive for fecal coliform.

Swabs done on point of contact (tap handle) showed that the household and community taps had no heterotrophic bacteria, pseudomonas, salmonella, E. coli and fungi. However, untreated and treated samples had counts of  $1.2x10^3$  and  $1.54x10^3$  cfu/5cm<sup>2</sup> for THBC. Only the treated swab sample had  $1.0x10^2$  and  $3.0x10^1$  cfu/5cm<sup>2</sup> for pseudomonas and salmonella. Swabs gotten from untreated and treated had fungal count of  $1.2x10^2$  amd  $6.0x10^1$  cfu/5cm<sup>2</sup>. In Figure 1 are reported a comparison of organisms at each site.

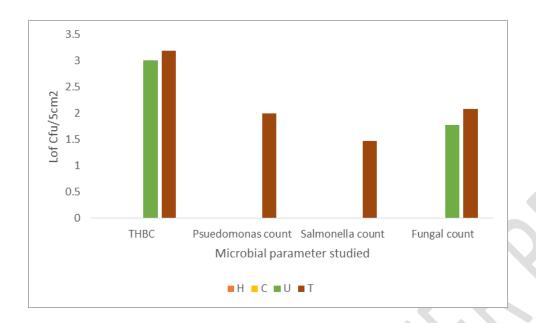

In the legends it should be pseudomonas not psuedomonas, and the x axis legend should be Organisms found

Fig. 1: Microbial Counts Obtained from Point of contamination Swabs in Bonny samples.

Isolated bacterial species and their biochemical?? morphological characteristics are as shown in Table 3

Table 3: Morphological Characteristic Isolates Obtained from Pipe-borne Water and Swabs

Key= SU1-SU2= Swab Untreated; ST1-ST2= Swab of Treated OW1-OW5= Omoku water this legend should be included at the last line of the Table

S/no	Isolate code	Colour	Size (mm)	Shape	Margin	Opacity	Elevation	Surface	Texture	
1	SU1	Yellow	0.5	Round	Entire	Opaque	Convex	Shiny	Smooth	Staphylococcus sp.
2	SU2	Cream	2.0	Round	Irregular	Opaque	Convex	Dull	Mucoid	Proteus sp.
3	SU3	Yellow	3.0	Round	Entire	Opaque	Flat	Dull	smooth	Micrococcus sp.
4	ST1	Cream	0.5	Round	Irregular	Opaque	Convex	Shiny	Smooth	Proteus sp.
5	ST2	Yellow	0.5	Round	Irregular	Opaque	Flat	Shiny	Smooth	Micrococcus sp.
6	ST3	Cream	0.8	Round	Irregular	Opaque	Convex	Dull	Mucoid	Salmonella sp.
7	OW1	Cream	0.5	Round	Entire	Opaque	Puncti form	Shiny	Smooth	Micrococcus sp.
8	OW2	White	2	Round	Entire	Opaque	Convex	Shiny	Smooth	Bacillus sp.
9	OW3	Cream	0.5	Round	Entire	Opaque	Flat	Shiny	Smooth	Salmonella sp.
10	OW4	Cream	0.5	Round	Irregular	Opaque	Flat	Shiny	Smooth	Vibrio sp.
11	OW5	Yellow	1	Round	Convex	Opaque	Puncti form	Dull	smooth	Micrococcus sp.
Here Key:										

You need to add a short discussion of the table

The isolates showed different occurrence frequencies in all samples as shown in Fig 2.

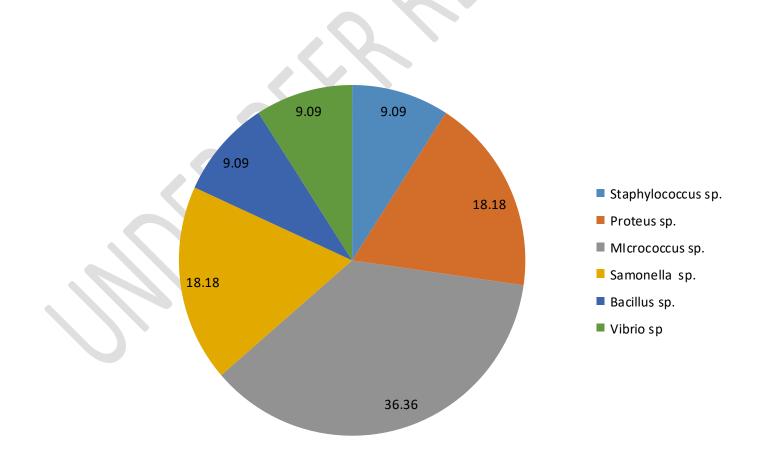


Fig 2 : Percentage Occurrence of Bacterial Isolates Obtained from Pipe-borne Water and Swabs

You need to add a short discussion about the Figure

# In Table 4 it is reported the antimicrobial .....

Table 4: Antimicrobial Susceptibility Pattern of Gram Positive Isolates from Pipe-borne Water and Swabs

Sample	Organism	CN	AML	RD	S	NB	СН	CPX	Е	LEV	APX
code											
SU1	Staphylococcus	S	S	I	S	S	S	S	S	S	S
	sp.										
SU3	Micrococcus	S	S	I	S	S	S	S	S	S	S
	sp.										
ST2	Micrococcus	S	S	I	S	S	S	S	S	S	S

	sp.										
OW1	Micrococcus sp.	S	S	I	S	S	S	S	S	S	S
OW2	Bacillus sp.	S	S	I	S	S	S	S	R	S	S
OW5	Micrococcus sp.	S	S	I	S	S	S	S	S	S	S

Key:it should be included in the last line of the table SU= Swab of Untreated tap, ST= Swab of Treated tap, OW = Omoku Water, S= Sensitive, I= Intermediate, R= Resistant. CN= Gentamycin, AML = Amoxil, RD= Rifampicin, S= Streptomycin, NB = Norfloxacin, CH= Chloramphenicol, CPX= Ciproflox, E = Erythromycin, LEV = Levofloxacin, APX = Ampiclox.

The antibiotics susceptibility pattern of the isolates revealed that most Gram's positive isolate were sensitive to all the antibiotics tested. The Gram's negative isolates were resistant to PN and NA except for salmonella that was sensitive for PN.

In Table 5 is reported the .....

Table 5: Antimicrobial Susceptibility Pattern of Gram Negative Isolates from Pipe-borne Water and Swabs

Sample	Organism	CN	AU	CPX	SXT	S	PN	CEP	OFX	NA	PEF
code											
SU2	Proteus sp.	S	S	S	S	S	R	S	S	R	S
ST1	Proteus sp.	S	I	S	S	S	R	I	S	R	I
ST3	Salmonella sp.	S	I	S	S	S	S	S	S	R	S
OW3	Salmonella sp.	S	I	S	S	S	S	S	S	R	S
OW4	Vibrio sp.	S	S	S	S	S	I	I	S	S	S

Key: SU= Swab of Untreated tap, ST= Swab of Treated tap, OW = Omoku Water, S= Sensitive, I= Intermediate, R= Resistant. CN= Gentamycin, AU= Augmentin, CPX= Ciproflox, SXT = Septrin, S = Streptomycin, PN = Amplicin, CEP = Ceporex, OFX = Tarivid, NA= Nalidixic acid, PEF = Reflacine.

The Physicochemical analysis of the treated and Untreated Bonny pipe-borne water shows that the untreated water had some parameters that exceed the limits specified by regulatory bodies (WHO). Specifically the pH, conductivity, total dissolved solids, alkalinity, salinity, turbidity, chloride, iron, sulphate, phosphate, lead, zinc and nitrate levels were within standard while odour, taste, chlorine and total Hardness of the treated water were above the regulatory limits and was as a result of chlorine used during treatment.

The microbiogical quality of the Bonny pipe-borne water were within regulatory standards. However, this could be due to the high chlorine level in the treated water which could be causing some toxicity to the body as revealed by the chemical analysis result. No faecal coliform was found in the water samples analysed. However pathogenic organisms were found in Omoku water samples. Therefore, reliance of Omouku people on tap water sources without proper treatment facilities and poor basic hygiene practices may therefore pose a serious public health risk especially to those that do not have other alternative water sources. Like the general saying "water is life", but microbiologically speaking, "quality water is life".

Characterisation of Microorganisms isolated from swab and water samples revealed the following genera; *Staphylococcus* sp., *Micrococcus* sp., *Proteus* sp., *Salmonella* sp., *Bacillus* sp., and *Vibrio* sp.

#### **CONCLUSION**

Further research such as Animal studies should be done to understand the harmful effects and toxicity of consumption of Bonny pipeborne water on human body.

Measures should be put in place to ensure proper quality control of the Bonny pipe-borne water to ensure that the water meets regulated standard. There should be regular monitoring, inspection and sanctions by regulatory bodies to enforce existing water quality standard regulations. Under-ground pipes should be properly checked for breakages that may lead to microbial contaminations.

To determine the actual biocide inhibiting microbial growth in the untreated water, the volatile and non-volatile components of the water should be analysed using High Perferomance Liquid Chromatography Methods and Gas Chromatography-Mass Spectrometry (GC-MS). Also, to determine the absence of Microorganisms in the water, the total Viable but non-cultural Microorganisms should be determined using appropriate techniques.

#### **COMPETING INTERESTS DISCLAIMER:**

Authors have declared that no competing interests exist. The products used for this research are commonly and predominantly use products in our area of research and country. There is absolutely no conflict of interest between the authors and producers of the products because we do not intend to use these products as an avenue for any litigation but for the advancement of knowledge. Also, the research was not funded by the producing company rather it was funded by personal efforts of the authors.

**REFERENCES** I think these references are not enough

Akani, M.P., Amadi, L.O. & Amafina, I.M. (2021). Assessment of Physicochemical and Bacteriological Quality of Well Water Samples in Ido Community, Nigeria. *Microbiology Research Journal International*. 31(1): 1-10.

Chan, C.L., Zalifah, M.K., & Norrakiah, A.S. (2007). Microbiogical and Physicochemical Quality of Drinking Water. *The Malaysian Journal of Analytical Sciences*. 11(2): 414 -420.

Ginige, M.P., Garbin, S., Wylie, J. and Krishna K.C (2017). Effectiveness of Devices to Monitor Biofouling and Metals Deposition on Plumbing Materials Exposed to a Full-Scale Drinking Water Distribution System. *PLoS ONE* 12(1): e0169140. doi:10.1371/journal.pone.0169140.

Isola, G.A., Ayanola, P.S. & Bayode, O.P. (2021). Assessment and Comparative Study of radon level in water samples collected within Ogbomosho Metropolis, Oyo State, Nigeria. *International Journal of Sciences: Basic and Applied Research*. 57(1): 16-22.

Peiyue, L. & Jianhua, W. (2019). Drinking Water Quality and Public Health. Springer. https://doi.org/10.1007/s12403-019-00299-8.